



SHINING 3D



FreeScan Trio

V 1.3.1

User Manual

Table of Contents

Overview

Welcome

- Symbol conventions
- About the document

Device

- Appearance
- Laser Information
- Labels
- Connect Cables

Installation

- Recommended PC configuration
- Software installation
- Graphics card

Activation

- Registration
- Login
- Device Activation
 - Online Activation
 - Offline Activation

Upgrade

- Firmware upgrade
- Software upgrade

Interface

Running environment detection

Quick guide

Quick calibration

- Steps

Scan

Workflow

Preparation

- Marker
- Spraying

Scan mode

Project and project group

- Project group
 - Create a project group
 - Open a project group
- Project

Project setting

- Laser scan

Scanning

Settings

- Laser scan
 - Scan mode
 - High-speed Mode
 - Light source mode
 - Object
 - Outdoor Mode
 - Local enlarged view
 - View lock
 - Brightness
 - Scanning distance indicator

Scanning

- Preview / Start Scan / Pause Scan
- Generate point cloud

Data editing

- Edit scanned data
- Shortcut
- Cutting plane
 - Create cutting plane
 - Set cutting plane

Functions

Alignment

Post processing

Mesh model

- Mesh optimization

Mesh editing

- Left panel
- Bottom panel
- Right panel

Measurement

- [Create features](#)
- [Movement](#)
- [Measurement tools](#)

Save

- [Save data](#)
- [Date sharing](#)
- [Third-party software](#)

Contact us

Overview

Welcome

Symbol conventions

Symbol	Description
	Note: This symbol is used to inform you of the additional information of the product.
	Caution: This symbol is used to inform you of incorrect operations that may damage the device or result in data loss. Any damages resulting from misuse are not covered by the warranty.
	Warning: This symbol is used to inform you of the potential risks that may result in serious personal injury and other safety incidents.

About the document

This document is related to your safety, lawful rights, and responsibilities. Read it carefully before installing and using the product.

- SHINING 3D Tech Co., Ltd. (hereinafter referred to as “the Company”) owns complete intellectual property rights for the contents of this document and, without the written consent of the Company, it is not allowed to copy, transmit, publish, reedit, compile or translate any contents of this document for any purpose or in any form.
- The document is a guidance for installing, operating, and maintaining the product, including the Device, software, or other products provided by the Company, to which the document is applicable. The document does not serve as the quality guaranty for the product. While the Company makes all efforts to ensure the applicability of the content of the document, it reserves the right to interpret and modify the content of the document and possible errors and omissions therein. The contents of the document are subject to changes without further notice.
- Images and diagrams in the document are presented to provide convenience to readers. In the event that any images or diagrams are inconsistent with the physical product, the later shall prevail.
- It is recommended that professionals or technicians shall operate and/or use relevant Products. The Company shall not be held responsible for any damages and/or losses caused by negligence, environmental factors, improper maintenance and use, or any other factors other than due to the quality of the Product.
- Disputes arising from the document and related Products thereof shall be governed by the laws of the People’s Republic of China.

- In the event of any ambiguity and/or any advice on the contents of the document, contact us by the contact information in this document.

Device

FreeScan Trio (hereinafter referred to as "scanner") is a handheld laser 3D scanner independently developed by Shining 3D Tech Co., Ltd, featured in the fast scanning speed, complete data acquisition, and convenient handholding operation. Besides, the device supports repeatable high-precision operations, without discrimination on the material and color of the objects to be scanned. Therefore, black or reflective surfaces are still scannable. The scanner's built-in patented binocular photogrammetry module provides users with technical solutions that can be applied to different scanning scenarios.

Appearance



No.	Function	>Description
1	Scanning Distance Indicator	<ul style="list-style-type: none"> • Red: too close • Yellow: relatively close • Green: suitable distance • Greenish-blue: relatively far • Blue: too far
2	Zoom Button	Adjustment of the size of data displayed in the preview window <ul style="list-style-type: none"> • Press the up button: zoom in. • Press and hold the up button: turn on/off the Local Enlarged View function. • Press the down button: zoom out. • Press and hold the down button: turn on/off the View Lock function.
3	Power Indicator	<ul style="list-style-type: none"> • Greenish-blue: power up and connect the USB port • Green: preview • Red: scanning • Blue: pause/finish scanning
4	Camera Brightness Button	<ul style="list-style-type: none"> • Press the left button: turn down the brightness • Press the right button: turn up the brightness
5	Middle Button	<ul style="list-style-type: none"> • Press: the menu pops up/confirm • Press and hold: Change the number of laser lines
6	Scanning Button	<ul style="list-style-type: none"> • Click: Preview(optional)/Start Scanning/Pause Scanning. • Press and hold: Generate the point cloud.
7	USB Port	/
8	Power Supply Port	/

Laser Information

Class 2 Laser Product

Laser power: <1mW

Wavelength: 450nm

Complies with FDA performance standards for laser products except for conformance with IEC 60825-1 Ed.3., as described in Laser Notice No.56, dated May 8,2019.


 **Caution**

Use of controls or adjustments or performance of procedures other than those specified herein may result in hazardous radiation exposure.

Lables




Read the content on the yellow sticker carefully before using the device.

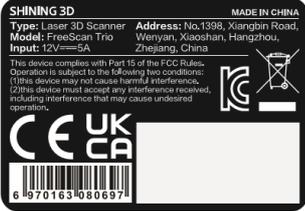Identification Lable	Warning Label & Certification Lable	Laser Logotype Lable
		

Logo	Description
	<p>LVD/EMC Directive This product complies with the European Low Voltage Directive 2014/35/EU and EMC Directive 2014/30/EU.</p>
	<p>WEEE Directive-2012/19/EU The product this manual refers to is covered by the Waste Electrical&Electronic Equipment(WEEE) Directive and must be disposed of in a responsible manner.</p>
	<p>The UKCA marking is the product marking used for products being placed on the market in Great Britain (England, Scotland and Wales).</p>

Connect Cables

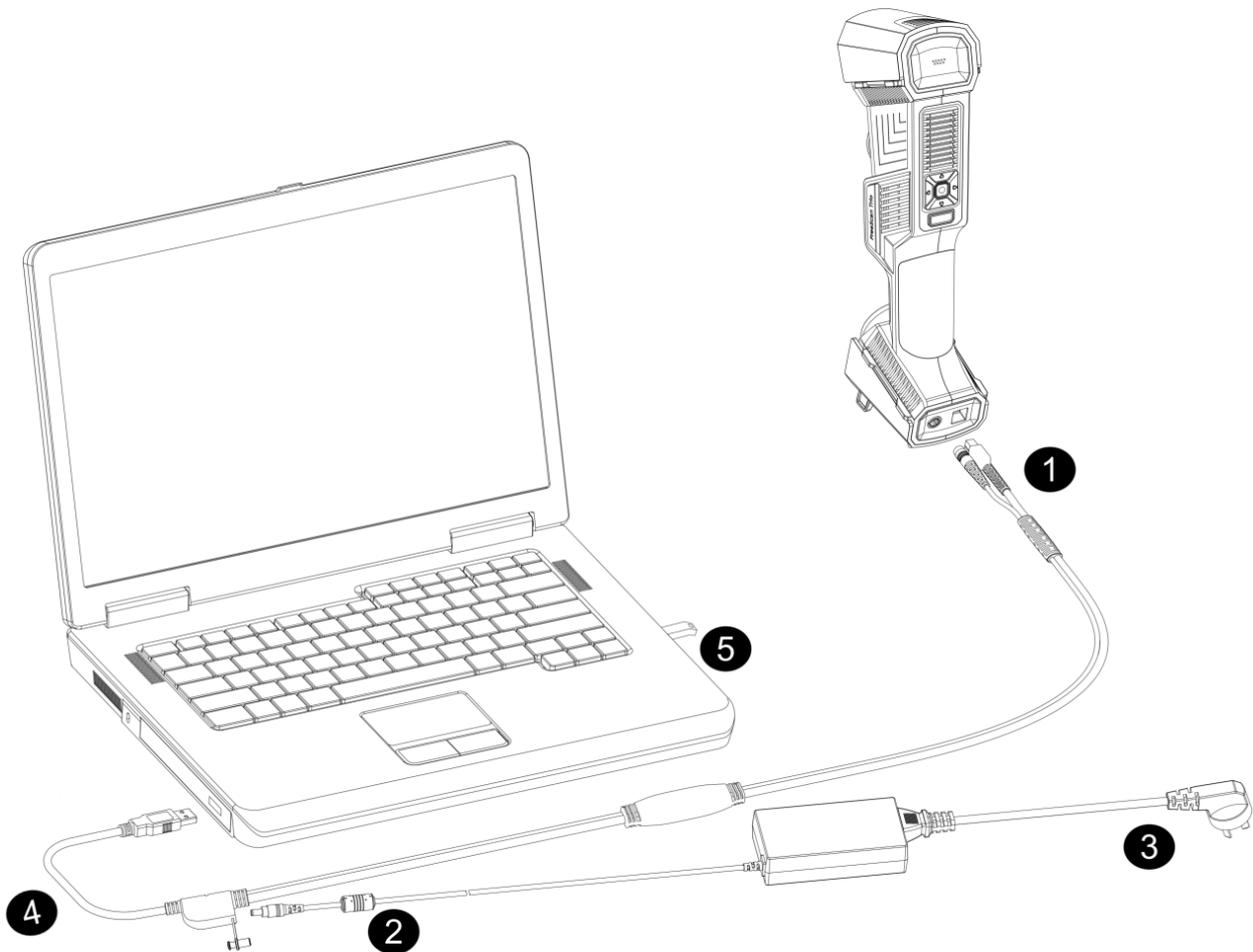

 **Caution**

Make sure you are using the correct power adapter (12V/5A).

Steps

1. Connect aviation cable to the power port and the USB port on the scanner.
2. Connect power cord (3) and the power adapter.
3. Connect power adapter (2) into aviation cable (4).
4. Connect USB port on the aviation cable to the PC USB 3.0 port.
5. Insert the Dongle (5) into the PC USB port.
6. Plug in socket to power up.

 **Note**

- Please ensure that the external adapter for the computer is plugged in.
- It is recommended to use hardware configuration with dual-channel memory.

Installation

Install FreeScan Trio to use the scanner(hereinafter referred to as the "software").

Recommended PC configuration

Configuration	Recommendation
CPU	Intel® Core™ i7-11700 or above
Graphics Card	NVIDIA GeForce RTX 3060 or above
VRAM	6GB or above
RAM	32GB or above
USB	USB3.0
Operation System	Windows 10 (64-bit) and Windows 11 Pro (64-bit)

Software installation

Steps

1. Insert the flash drive.
2. Copy the installation file to the PC and run it.
3. Install the software by following the installation wizard.
4. Click **Finish** and run the software.

Note

- Administrator rights are required for the software installation. The initial installation environment may take a long time, please wait patiently.
- Please do not install the software in **C:\Program Files** or **C:\Program Files (x86)**. The software will not run when installed under these folders due to restricted rights.
- After installing the software, please follow these steps to ensure smooth operation: Go to **Windows Settings > About > Advanced system settings > Performance > Adjust for best performance**. By adjusting the system settings for optimal performance, you can ensure that the software runs smoothly.

Graphics card


It is recommend to use a discrete graphics card instead of integrated graphics card for better performance.

Desktop

- Connect your display to the port of discrete graphics card on the back of your computer.

Laptop

- Launch **NVIDIA Settings** on your laptop.
- In **3D Settings > Manage 3D Settings > Global Settings**, select **High-performance NVIDIA processor** and click **Apply**.

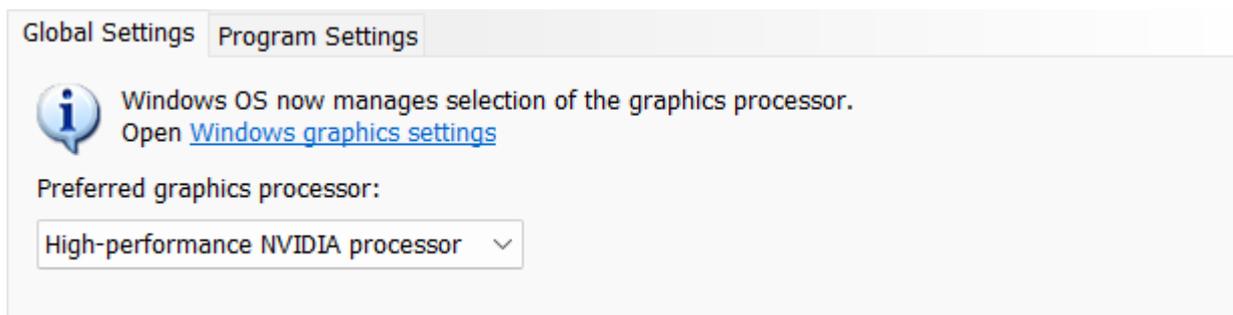

Activation

When using the scanner for the first time, please register an account to activate the device.

Registration

Click **Register** and fill in the account information in the registration pop-up.

Create an account

+86 China 中国

State/region do not support modification after submission,
please choose cautiously

Enter phone number or email



Click the button to start verification

Please enter the verification code [Get Code](#)

Please enter your name

Enter at least 6 characters password

Please enter the password again

Read and agree our [《Privacy policy》](#) [《Terms of use》](#)

Sign Up




Note

- Enter valid email or phone number to get verify code for registration.
- Fill in correct user information for better service.

Login

Log in with your account or verification code.

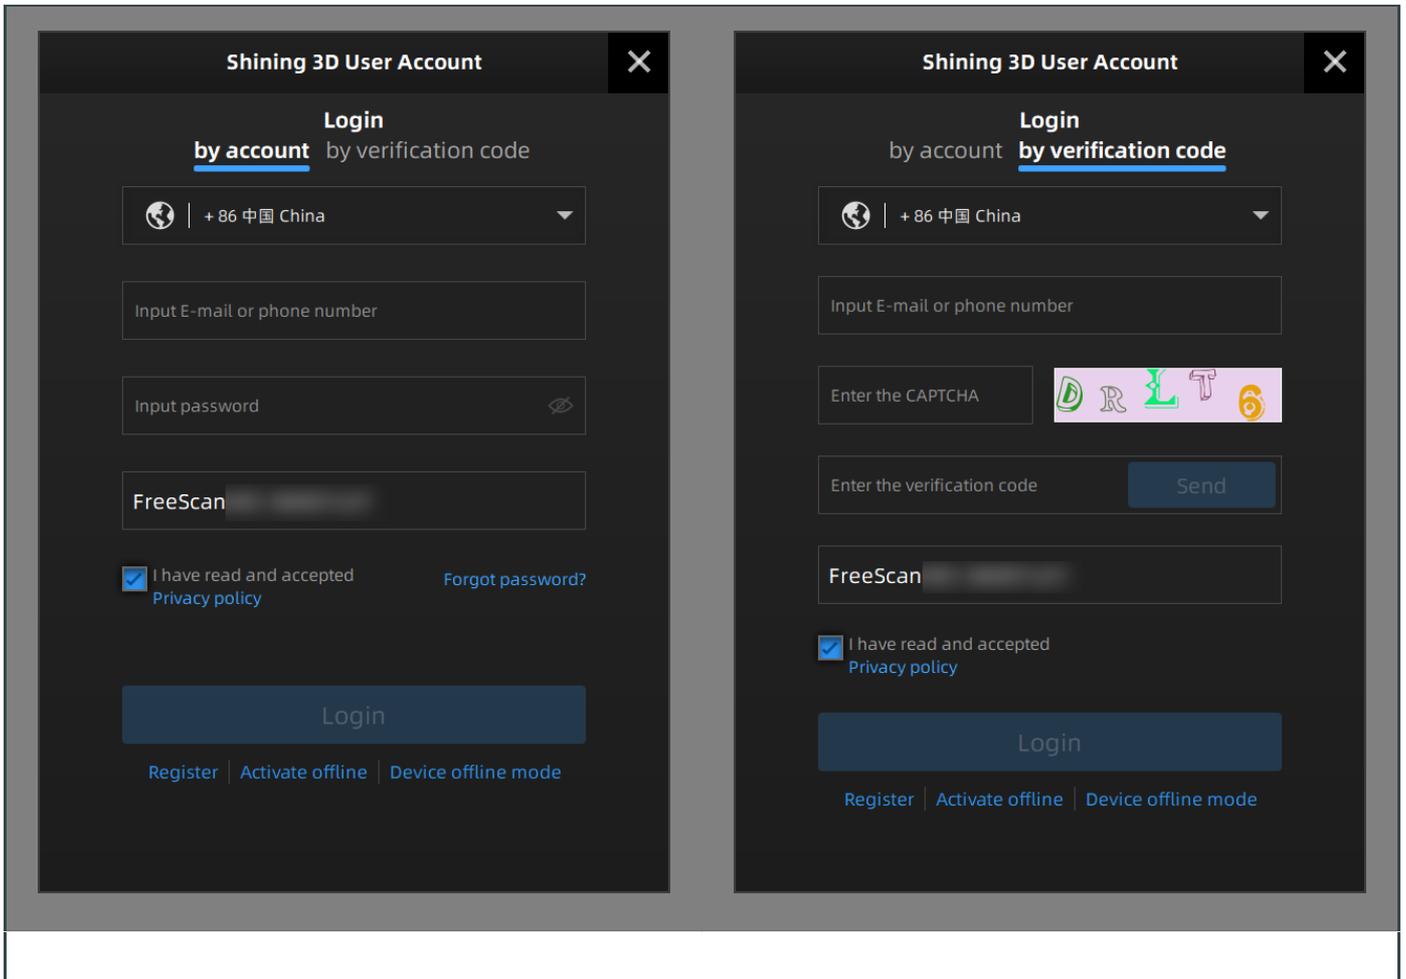

Device Activation

Online Activation

The activation will be completed automatically after logging in successfully on the networked computer.

Offline Activation

If the PC cannot be networked, activate the scanner offline.

Offline activation wizard

Follow the instructions below to register your account and activate the scanner offline:

Step1	Step2	Step3
Connect the scanner to this computer. Insert dongle and input serial number. Click "Export" to export C2SN3D file and save the file to the computer with network.	Register your account at https://passport.shining3d.com . Click "Offline Activation" from the account page, and upload the C2SN3D file. Then, download the SN3D2C file.	Transfer the downloaded SN3D2C file to this computer, and import the file by clicking "Import".

Input device serial number: FreeScan

Export Import

1. Export C2SN3D file.
 - (1) Prepare a USB flash drive or portable hard disk.
 - (2) Insert the dongle to your PC.
 - (3) Enter the device serial number.
 - (4) Click Export. And save the C2SN3D file to a USB flash drive.
2. Upload C2SN3D file.
 - (1) Enter <https://passport.shining3d.com/login> on the networked computer. Then log in or register a new account.
 - (2) Click OFFLINE ACTIVATION.
 - (3) Upload the C2SN3D file.
3. Export the SN3D2C file corresponding to your scanner account to your USB flash drive.
4. Import the SN3D2C file to your Shining Pass (in your PC with the software). Then insert the dongle to the PC to enter the software main interface.

 **Note**


If none of the above methods can activate your device, please contact the supplier or technical support.

Upgrade

When a new version of the software is released or a higher firmware version is available, you will be prompted when launching the software.

Firmware upgrade

Update the firmware for better performance, stability or bug fixing. Click **Upgrade** to start the firmware upgrade, as shown below.

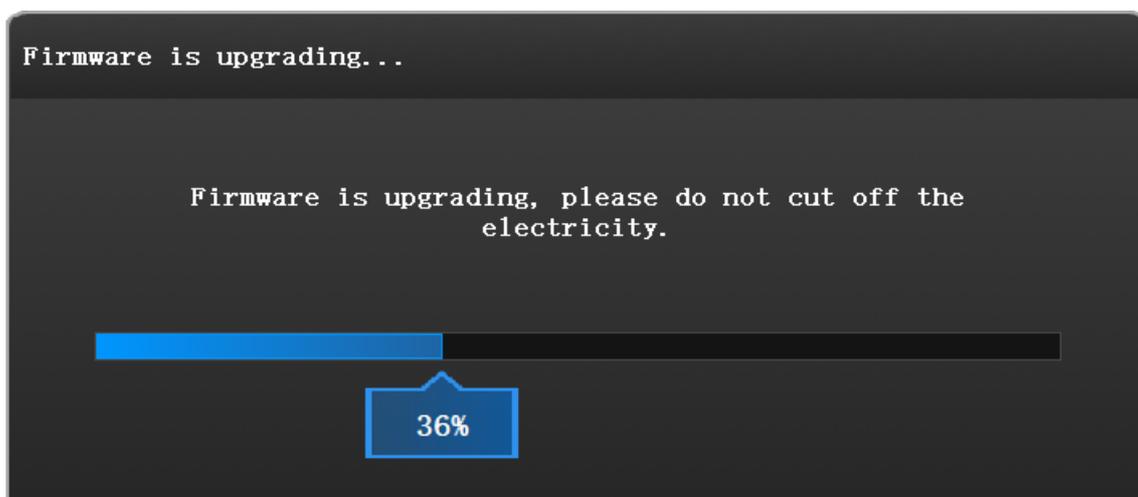


Caution

- Make sure that the device is powered on during the upgrade; avoid interruption of the upgrade due to power cuts.
- Do not use mismatched software, firmware and scanners, because this may affect the scanning effect. If in doubt, please contact your supplier or technical support
- If the upgrade fails, please power off the device and reconnect it to upgrade again.


Software upgrade

Update the software for better performance, new functions or bug fixing.

It is recommended to use the latest software. Otherwise, the following prompt box will pop up when launching the software.

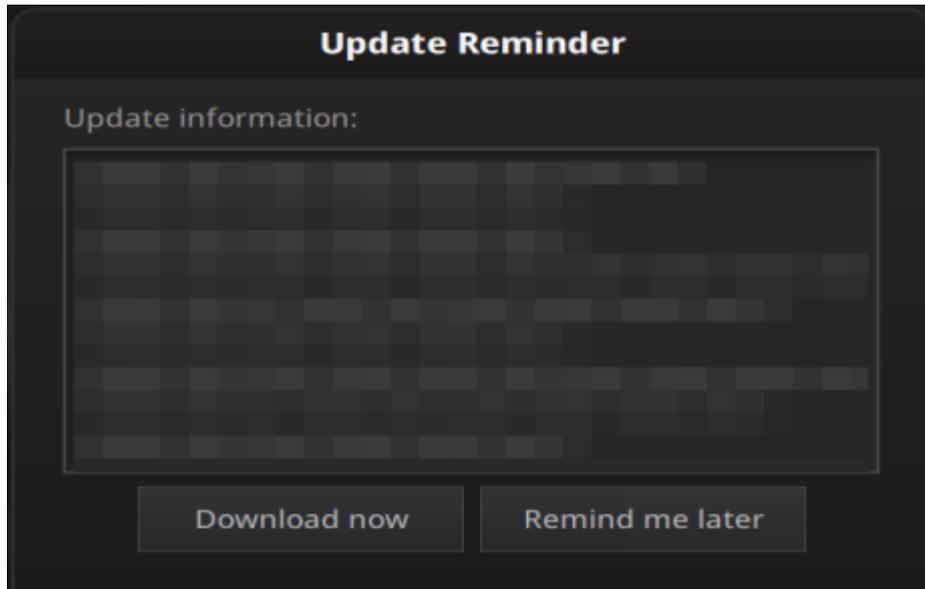

Click **Download Now** will download the installation package in the background. Do not close the software during the download process. When the download is completed, a window automatically pops up for users to decide whether the new version shall be installed immediately.

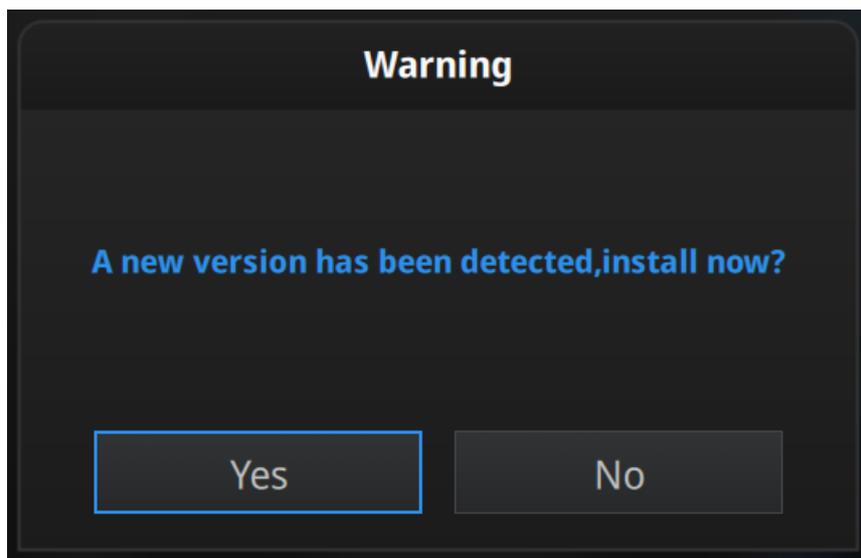


Click **Yes** to start installing.

 **Caution**

The software will be closed during upgrading. Please save your projects properly before upgrading.

Interface

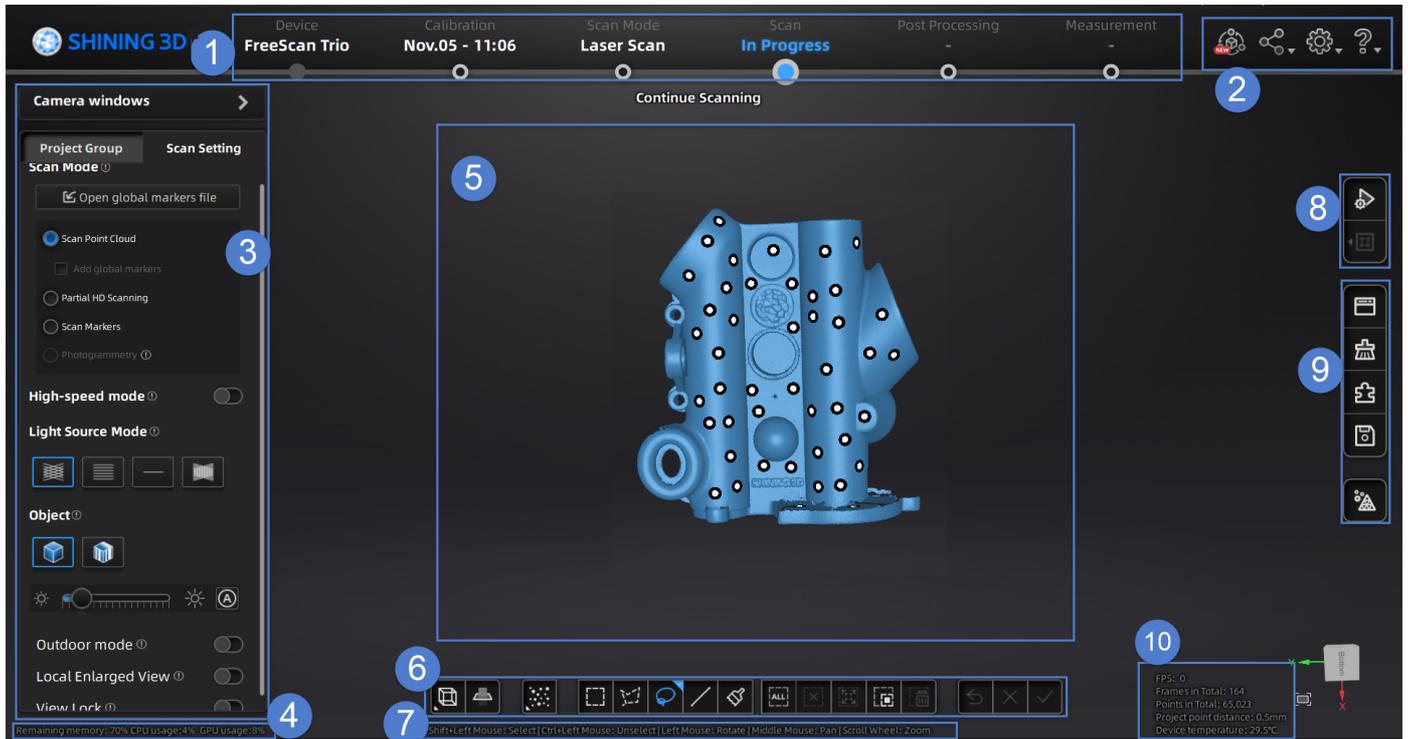

No.	Function	Description
1	Navigation Bar	<ul style="list-style-type: none"> • Device: Display the device status: online / offline. Click  to reconnect when the device is offline. • Calibration: Click it to calibrate. • Scan Mode: Choose the scan mode. • Scan: Go into scan process. • Post Processing: Go into post processing when you finish scanning, which includes mesh and mesh editing. • Measurement: To measure your model.

No.	Function	Description
2	Settings and Feedback	<ul style="list-style-type: none"> <li data-bbox="563 253 970 293">• Reverse Engineering Service  <hr data-bbox="563 322 1461 327"/> <li data-bbox="563 342 683 383">• Link  <ul style="list-style-type: none"> <li data-bbox="563 405 1445 479">- Official Website: Open the official website [🔗] of Shining 3D to learn about the company's products and information. <li data-bbox="563 488 1406 562">- Facebook: Enter Shining 3D's Facebook to view product introduction and other operations. <li data-bbox="563 571 1374 645">- Support Platform: Enter Shining 3D's support platform to view product introduction and other operations. <hr data-bbox="563 674 1461 678"/> <li data-bbox="563 696 730 736">• Settings  <ul style="list-style-type: none"> <li data-bbox="563 745 1430 860">- Running Environment Detection: Diagnose the running environment of the software. Check the device information and whether computer configuration meet the operating conditions. <li data-bbox="563 869 1350 943">- Preview: After checking the function, you can preview the scanning performance before scanning. <li data-bbox="563 952 1461 1144">- Scanning Distance Indicator: After checking the function, there is a bar on the left side of the scanning interface, displaying the scanning distance; After unchecking the function, the distance bar will no longer be displayed and the scanning distance can be adjusted according to the color of the laser lines. For more, see Scanning Settings. <li data-bbox="563 1153 1445 1227">- Advanced Mode: Check the box to select a smaller dot pitch when creating a new project¹. <li data-bbox="563 1236 1414 1310">- User Experience: To help us improve the user experience. We hope to be allowed to collect usage experience information and we will . <li data-bbox="563 1319 1406 1393">- Factory Default: All settings can be restored to the initial settings, and the software will restart automatically. <li data-bbox="563 1402 1222 1442">- Language: To set the language displayed in the software. <li data-bbox="563 1451 1414 1491">- About: View related software release information, contact information, etc. <hr data-bbox="563 1503 1461 1507"/> <li data-bbox="563 1525 691 1565">• Help  <ul style="list-style-type: none"> <li data-bbox="563 1574 999 1615">- User Manual: Open the user manual. <li data-bbox="563 1624 1453 1738">- Teamviewer: The quick access to remote assistance. Please send the ID and password in the pop-up window to the technical supporters for remote assistance.

No.	Function	Description
3	Scanning Settings	<ul style="list-style-type: none"> • Camera Window: To preview the actual scene during scanning. Parameters can be adjusted accurately through the camera window. <hr/> <ul style="list-style-type: none"> • Project Group: To manage projects and the project group. For more, see Project and Project Group. <hr/> <ul style="list-style-type: none"> • Scanning Parameters: To set scanning parameters. For more, see Settings.
4	Memory/CPU/GPU	<ul style="list-style-type: none"> • Remaining memory. • CPU usage: If the running program occupies a large proportion, it is recommended to close other software. • GPU usage.
5	Preview/Scanning Window	Window for viewing the preview and scanning model.
6	Edit Toolbar	For more, see Data Editing .
7	Shortcuts	Quickly move the model or adjust the angle through shortcut keys.
8	Scan & Generate Point Cloud	For more, see Scanning .
9	Side Toolbar	For more, see Functions .
10	Other Information	To show information about FPS, Frames in Total, Points in Total, etc.

1. **Advanced Mode:** the minimum point distance is 0.01mm on the Scan Point Cloud Mode and the Partial HD Scanning Mode;


Non-advanced Mode: the minimum point distance is 0.1mm on the Scan Point Cloud Mode; the minimum point distance is 0.02mm on the Partial HD Scanning Mode. [←](#)

Running environment detection

After running the software, click  > **Running Environment Detection** to check the device information and whether computer configuration meet the operating conditions.

- Click **Refresh** to detect again.
- Click **Confirm** to exit.

If it shows  , it means that the device information can be read normally or the configuration meets the operation requirements.

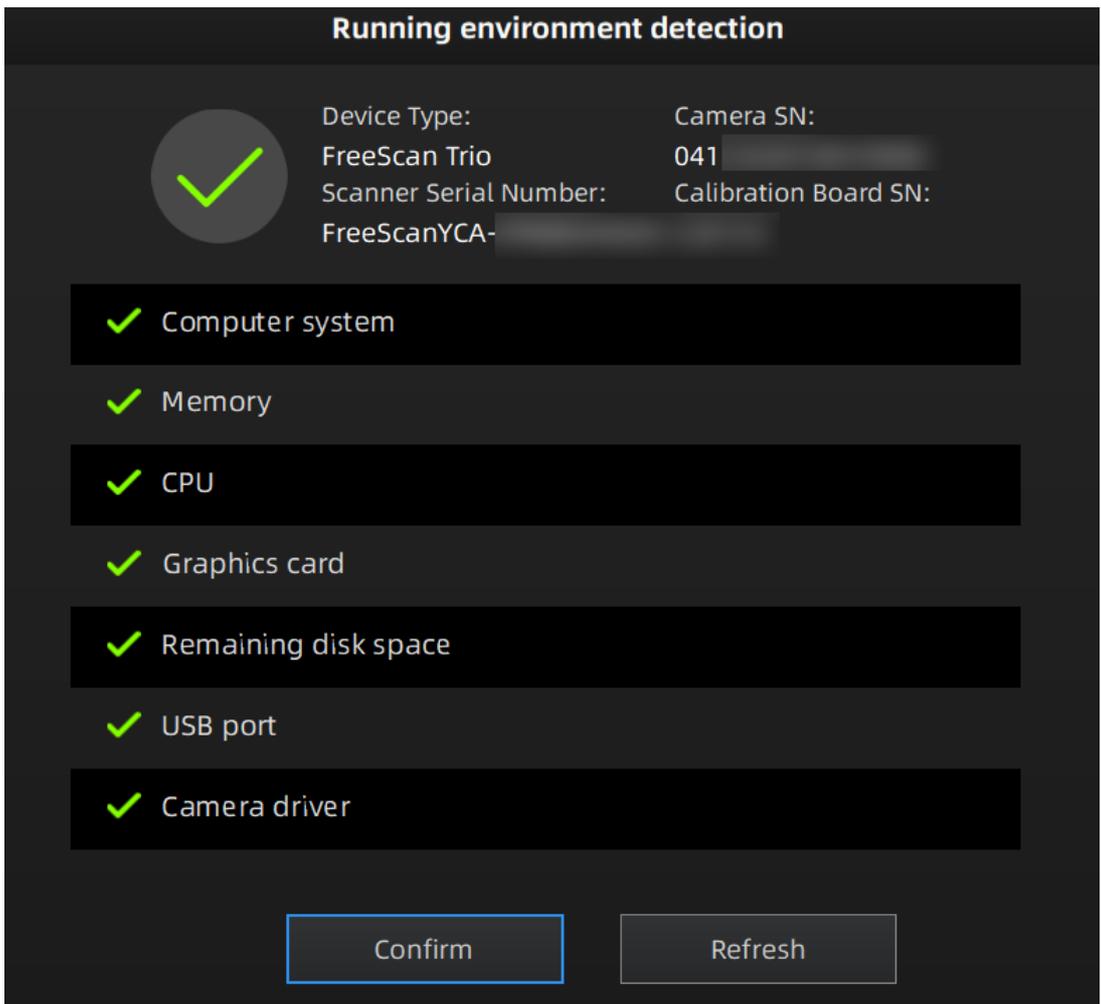

The image shows a software interface titled "Running environment detection". At the top left, there is a large green checkmark icon. To its right, the following information is displayed:

Device Type:	FreeScan Trio	Camera SN:	041
Scanner Serial Number:	FreeScanYCA-	Calibration Board SN:	

Below this information, there is a list of system components, each with a green checkmark icon to its left:

- Computer system
- Memory
- CPU
- Graphics card
- Remaining disk space
- USB port
- Camera driver

At the bottom of the interface, there are two buttons: "Confirm" (highlighted with a blue border) and "Refresh".

If the status is abnormal, please check the device connection, computer configuration or repair the problem according to the interface prompts.

Running environment detection



Device Type:

Scanner SN:

Camera SN:

Calibration Board SN:

✓ Computer system

✓ Memory

✓ CPU

✓ Graphics card

✓ Remaining disk space

✓ USB port

⚠ Camera driver

The current camera driver is incorrect
Recommend to restore (Click restore button to reinstall)

Restoration

Resto...

Confirm

Refresh

Quick guide

🔖 Step 1

If you are using the scanner for the first time, please perform the calibration first. Once the calibration is completed, the software will automatically skip this step when you enter it again.

→ [Calibrate](#)

🔖 Step 2

Before starting the scan, you need to select the storage path for the files and create a project.

→ [Create a project](#)

🔖 Step 3

After creating the project, you can set the scan parameters for the project to get better scanning results.

→ [Set up](#)

🔖 Step 4

Scan the object and obtain the data.

→ [Scan](#)

🔖 Step 5

Edit scanned data.

→ [Edit](#)

🔖 Step 6

Save scanned data.

→ [Save](#)

Quick calibration

Through calibration, the scanner parameters are recalculated, which not only ensures the accuracy of the scanner, but also improves the scanning quality.

Calibration is required under the following conditions:

- When the scanner is used for the first time, or when it is reused after being laid idle for a long period of time (1 - 2 weeks).
- The scanner was severely shaken or vibrated, such as shaken during transportation.
- Severe accuracy reduction, such as frequent errors in alignment or unrecognized markers.
- Incomplete data is acquired during the scanning or serious deterioration of the quality of scanned data.


⚠ Caution

- Start to calibrate when the temperature¹ of the scanner get high enough (25°C - 45°C).
- The calibration board is matched to the scanner. Calibrating with an mismatched calibration board will lead to inaccuracy or fail to get good scanned data.
- Always make sure that both sides of the calibration board are clean and free of scratches.
- Do not place heavy objects or sundries on the calibration board.
- Keep the calibration board away from corrosives, metals and sharp objects to avoid corrosion or damage.
- It is not recommended to wipe the calibration board. If needed, gently wipe it with a piece of a clean damp cloth. Do not use a cloth with chemicals or alcohols to wipe the calibration board.
- After using the calibration board, put it in a flannel bag.

Steps


Follow the steps provided by the calibration wizard on the right side of the interface.

1. Place the calibration board horizontally.
2. Place the scanner in the same direction as shown in the figure.
3. Align the center point of the Device's handle with the center point of the gray circle on the calibration board.
4. Press the scan button on the scanner to start calibration.

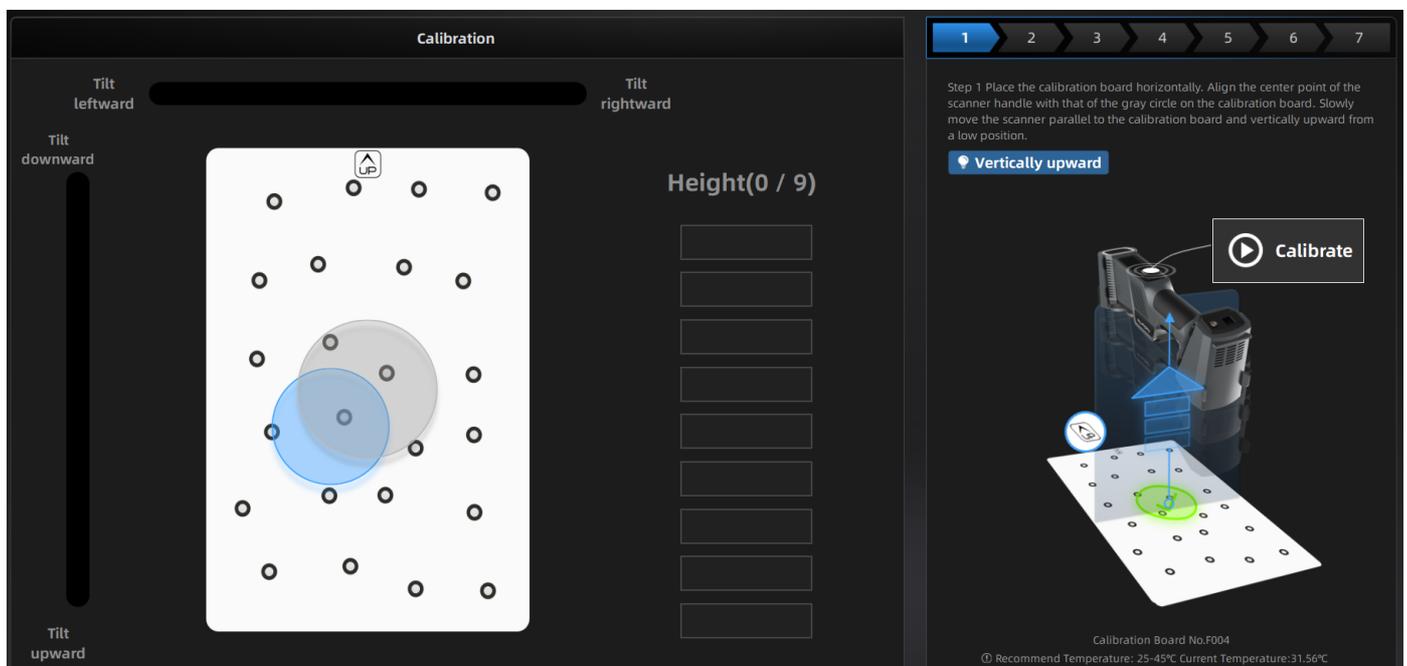

5. Move the device slowly and adjust the distance between the scanner and the calibration board according to the height indicating box.
6. Keep moving until all height boxes turn green.

7. Check the calibration result.

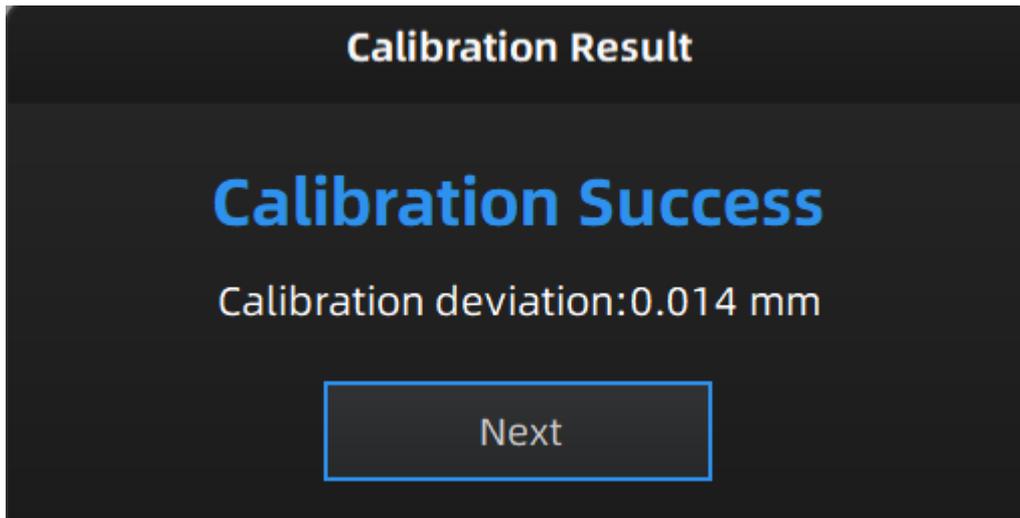

 **Note**

- Please calibrate again if the calibration fails.
- During the calibration process, please ensure that there are not a large number of markers around the calibration board, so as not to affect the calibration accuracy.
- Please contact the supplier or technical support if the calibration still fails after several attempts.

1. When the temperature of the scanner is between 30°C and 35°C, do calibration to get better scanning accuracy. [←](#)


Scan

Workflow


There are two different workflows: Basic workflow, Global marker workflow.

The basic scanning mode can meet most of general scanning needs, and the global markers scanning mode can be used when you need to scan for higher accuracy or scan thin-walled parts.

Basic Scanning Workflow

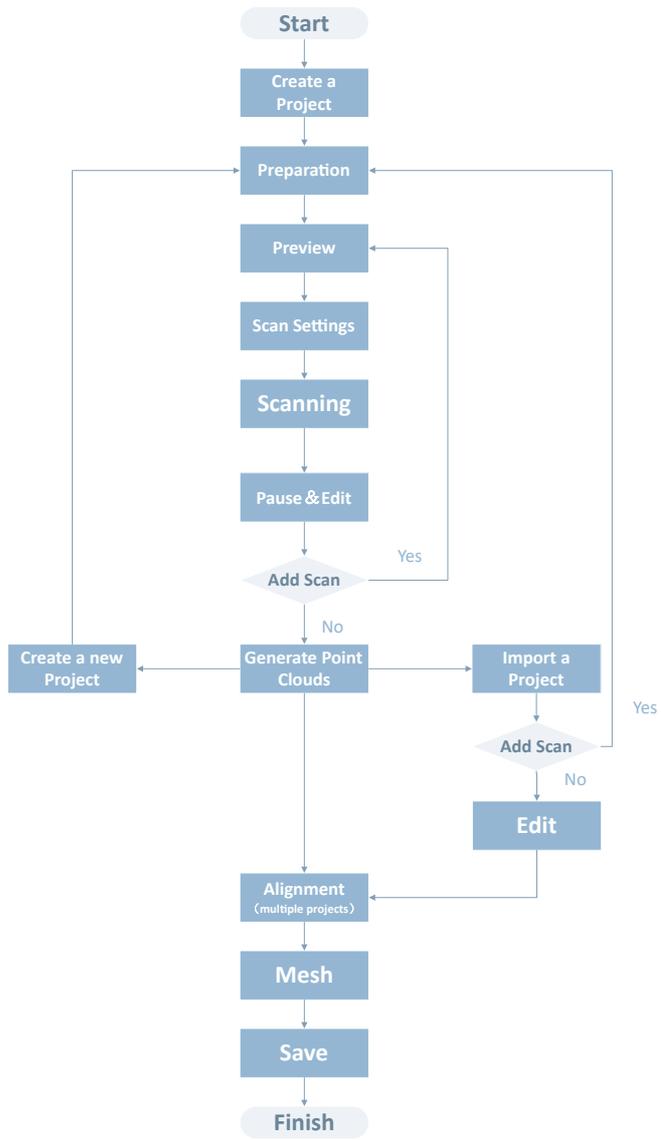

Global Markers Scanning Workflow

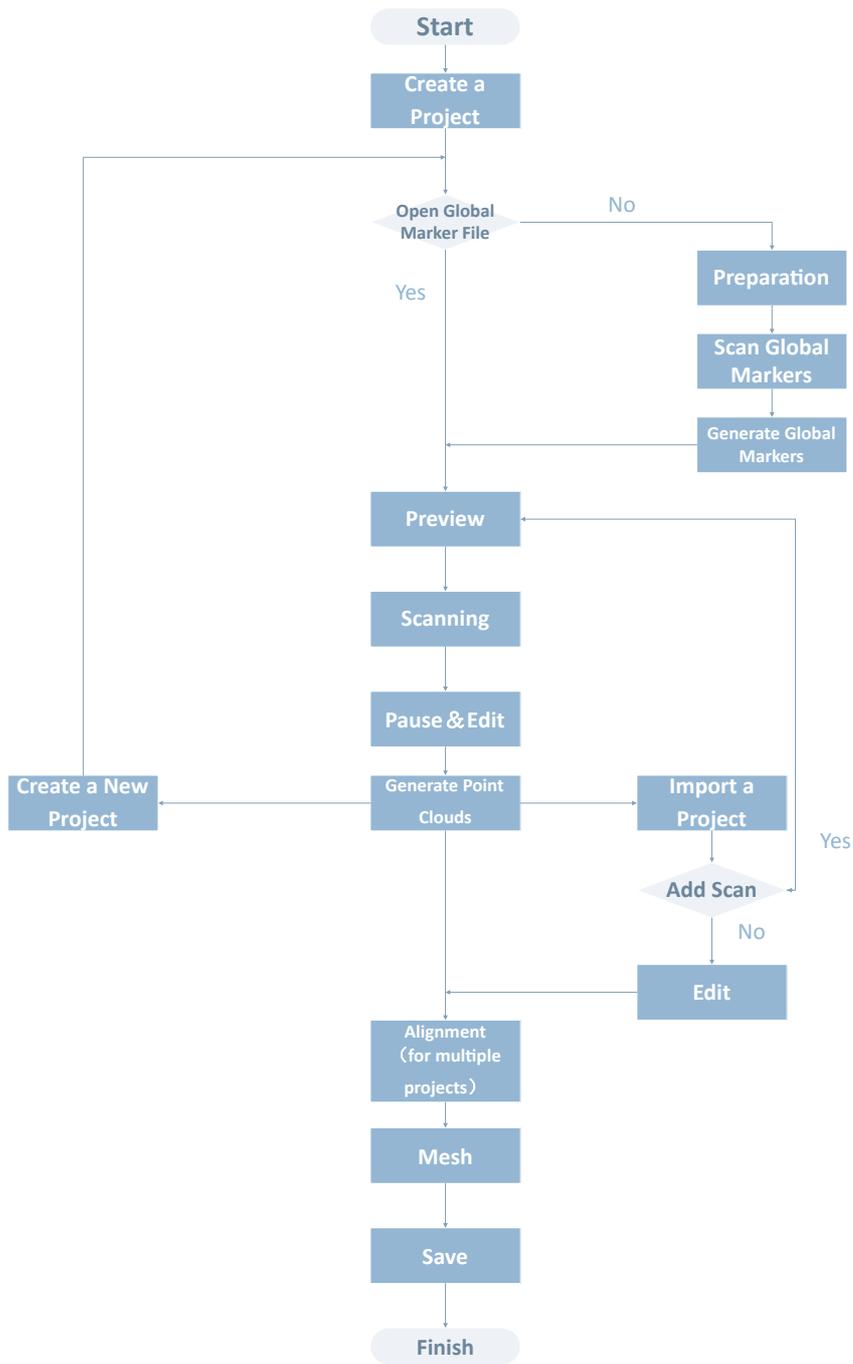


Preparation

Make some preparations when scanning different objects.

Marker

Markers shall be attached to models. If the device fails to catch markers, it will not emit laser lines in the laser scan mode. - Attach the markers evenly and randomly. - Four markers are required for the alignment at communal areas. - Ensure that the device's camera can scan at least 4 markers within the normal scanning range. - Please attach small markers¹ on the edges or at small facets of the model. - Do not attach the markers on the surface with high curvature. - Do not use damaged or incomplete markers. - Do not use greasy, dusty, or dirty markers.

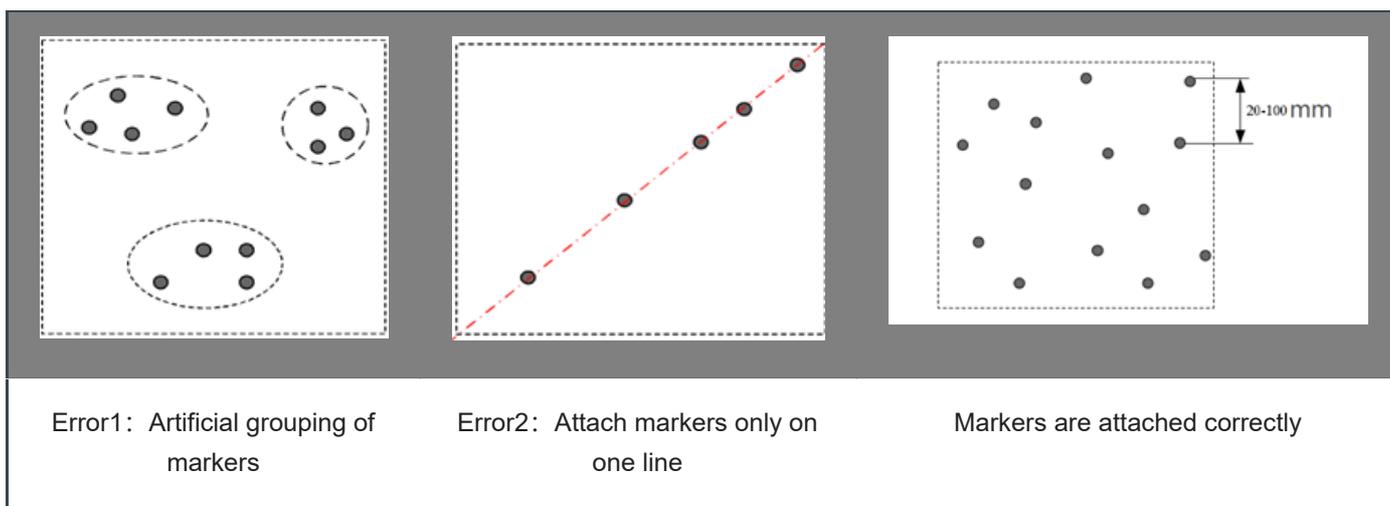

Spraying

Spray the washable or specified imaging agent on the transparent, shiny or reflective model before scanning.

Note

Objects are not recommend to scan:

- Soft material objects.
- Moving or vibrating objects. Frequent changes in the coordinates of such objects will result in poor scanning quality.

1. 3mm markers are the minimum markers identified in the laser scan mode. ←

Scan mode

Click **Scan Mode** and then create a [new project group](#) or open a [project group](#).

Project and project group


Create or open a project group before scanning.

Project group

Project group is the standard file structure of the software. It contains one project or more. Each project contains the scan data of its own. Project group is mainly used in the following scenarios:

Project Group	Scenario	Description
Only one project in the project group	One object needs to scan with only one alignment mode.	Only one alignment mode can be used in the same project.
Multiple projects in the project group	<ul style="list-style-type: none">• One object needs to scan with multiple alignment modes.• Multiple objects or one large object need to scan with one or more alignment modes	It is recommended to create multiple projects within one project group when scanning the large object, multiple objects and one projects with multiple alignment modes. After scanning, you can align these projects one by one.

Create a project group

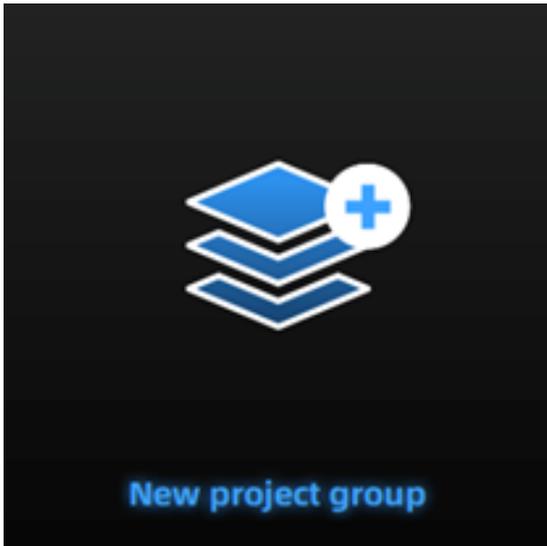

Two ways to create a project group:

Method One: Click **New project group** after selecting the scan mode process in the navigation bar.

Method Two: Click  and select **New project group** on the scanning page.

In the prompt window, select the storage path, name the project group and click **New**. All scanned data will be saved to the folder with the name you just set.


Open a project group

Two ways to open a project group:

Method One: Click **Open project group** after selecting the scan mode.

Method Two: Click  and select **Open project group** on the scanning page.

In the prompt window, select the project group file and then click **open**.

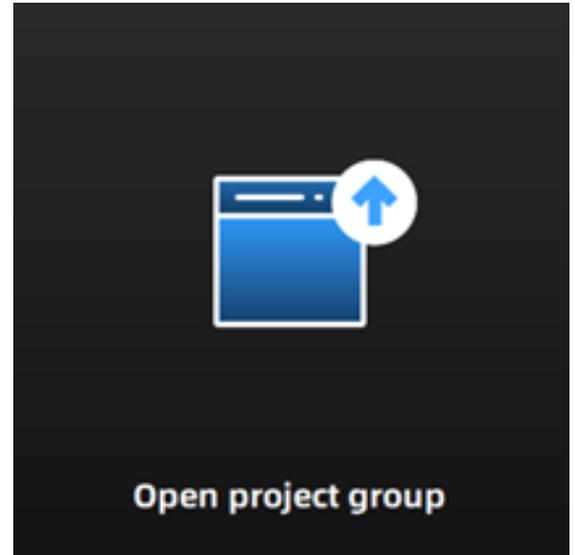


Note

- The current project group will be saved automatically when opening a project group.
- Only the project group scanned in the same scan mode can be opened.

Project

Each **project** is a part of the **project group**. All operations of **project** can be done by the following buttons.

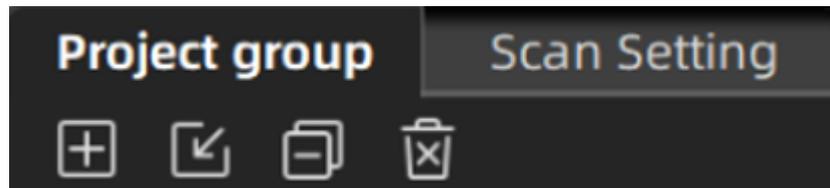

Icon	Function	Description	Note
	New Project	Two ways to create a project: 1. A project will be created automatically after click New project group . 2. Click  to create a new project on the scanning interface.	<ul style="list-style-type: none"> The project only can be created when the scanner is connected. The last project in the project list is the current project. Only the current project can continue to scan.
	Open Project	Two ways to open the project: 1. All projects of this group will be loaded to the software after opening the project group. 2. Click  to open the project group.	Cannot open the project group with different resolution or texture setting at the same time.
	Remove Project	Click  to remove selected project from the project tree.	The project can be opened again when needed.
	Delete Project	Click  to delete the project from the project tree, and delete all the data of this project.	The scanned data will be deleted from the computer permanently.
	Visible/Invisible	After clicking, the point cloud or markers can be displayed; click it again to hide the point cloud or markers.	/

Project setting

Laser scan

Three kinds of resolution are provided for quick selection, and you can also drag the slider to set it.

Level	Resolution
High Detail	0.2mm
Medium Detail	0.5mm
Low Detail	1.0mm



Note

- The smaller the resolution is, the more data details can be obtained, but the engineering data will be larger and the processing time will be longer.
- The new created project under the project group will automatically use the same resolution of the project group and the resolution cannot be modified.

Scanning

Settings

Laser scan

Scan mode

Choose the proper scanning mode to scan.

Scan Mode	Description
Scan Point Cloud	Acquire the data as point cloud. It could be switched to scan point cloud mode after scanning markers. It is also feasible to import the generated global marker file and then scan the point cloud.
Partial HD Scanning	Partial HD Scanning means selecting the area to be rescanned when the requirement of resolution is high. Targeted scanning can save scanning time and make the data obtained complete.
Scan Markers	Only scan markers. Acquire marker data fast. There is no laser line in the scanning process. Markers can be scanned to supplement in the global marker file generated before.  Caution When switching to Scan Markers , the current scanned data will be cleaned up and the data can not be recovered.
Photogrammetry	Photogrammetry can improve the accuracy of global markers data. According to the size of the scanned object, import suitable scale bar files and place the matching scale bar near the scanned object before starting the scanning. Generally, photogrammetry is suitable for measurements for big parts in industrial applications that require high accuracy.

High-speed Mode

The high-speed mode of the scanner will lose some details. Please turn off the mode when the point distance is less than 0.1mm. This mode cannot recognize 3mm markers.

Light source mode

Select the different mode of laser lines to scan.

Light Source Mode	Description
26 Lines	13 cross laser lines to scan large objects quickly
5 Lines	5 parallel laser lines to scan fine details
1 Line	A single laser line for deep holes and pocket area scanning
98 Lines ¹	<p>98 cross laser lines to scan large objects quickly.</p> <ul style="list-style-type: none">• Markers Mode: Stick markers on the object before scanning. This mode is used to scan objects with simple structure or repetitive features or to scan axisymmetric objects.• Features Mode: Align the scanned data automatically by the surface geometric features of the scanned object. This mode is used to scan objects with rich and asymmetric geometric features.• Hybrid Mode: A mix mode of Features Mode and Markers Mode. Stick markers on the surface of the subject with few features to scan. <p> Caution Only one above mode can be used for the same project.</p>

Object

Select different brightness levels according to the materials of different objects.

Outdoor Mode


To scan normally in the glare environment such as outdoors.

Caution

Please avoid direct sunlight when scanning objects.


Local enlarged view

When the function is enabled, the scanning interface only displays the local perspective of the scanned object, which can be used for supplementary scanning of small holes. It is recommended to enable under 0.2mm point distance.

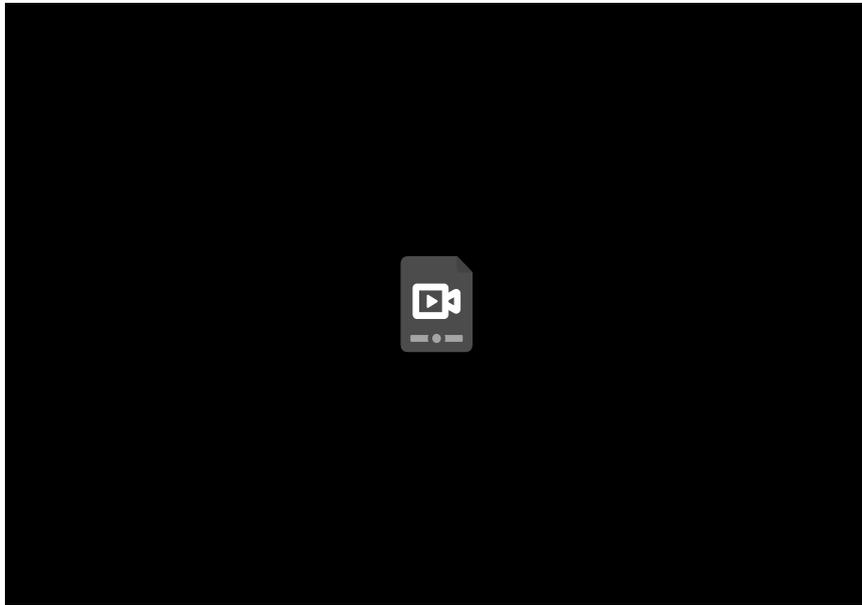


View lock

The object view will be locked during scanning and not follow the scanning path, when the function is enabled.

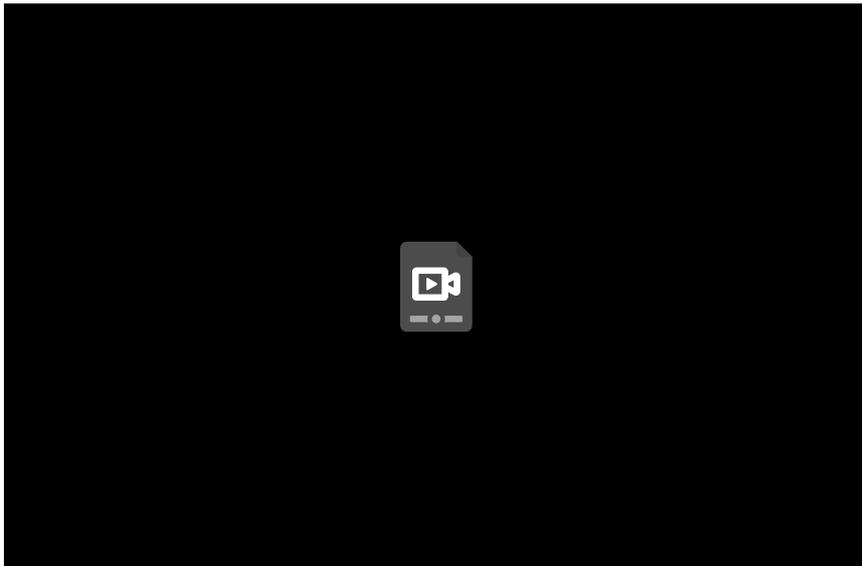


Brightness

For objects of different materials and colors, adjust the brightness of the scanner to scan better.

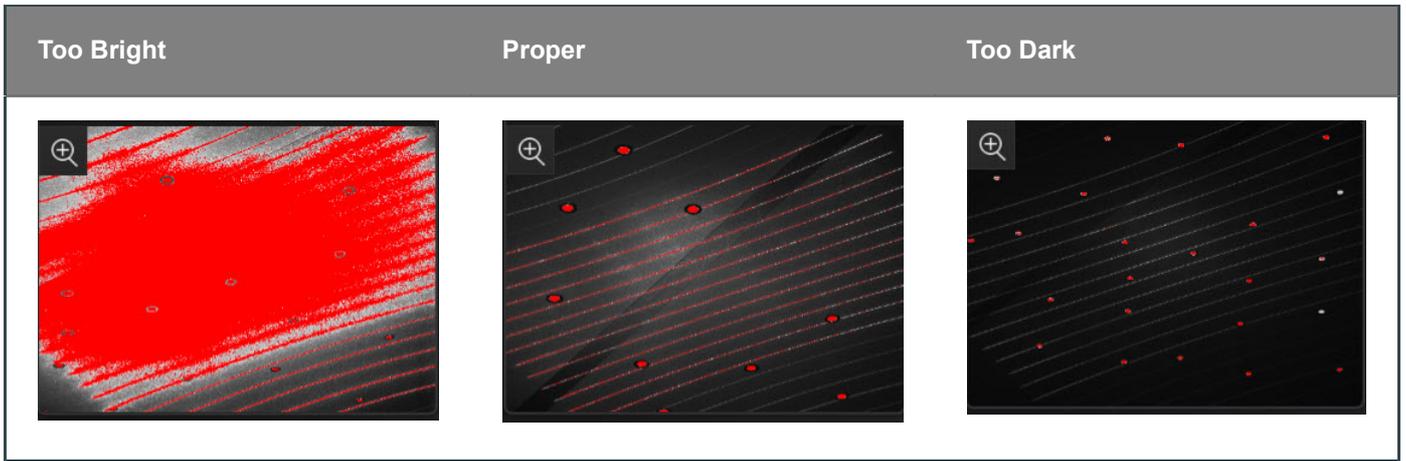

Scanning distance indicator

There is a bar on the left side of the scanning interface, displaying the scanning distance. Do adjustments according to the color of the indicator.

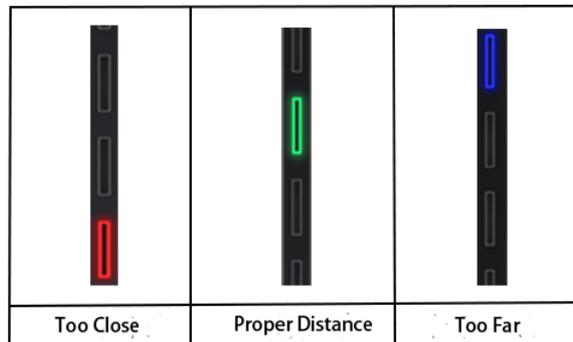

Click > **Scanning Distance Indicator** and uncheck the function, the distance bar will no longer be displayed. The scanning distance can be adjusted according to the color of the laser lines.



1. The Partial HD Scanning mode, High-speed mode and projects with a point distance below 0.2 are not supported on the 98-line mode.

The **Features Mode** and **Hybrid Mode** of 98-line mode do not support importing or scanning frame points, nor can they be used with photogrammetry at the same time; it can not switch the light source mode and the alignment mode when finishing the scanning; when the number of markers is <3, the plane detection will be turned on. ←

Scanning

Preview / Start Scan / Pause Scan

You can switch in these 3 status with the trigger on the scanner, or click the button in the software. The normal order is: **Preview**(optional) > **Scan** > **Pause**.

Function	Icon	Instruction
Preview(optional)		Preview and adjust the scan parameters for better scanning effects.
Start Scan		Click  to scan. During scanning, keep the scanner parallel to the surface, keep a proper distance from the object, and adjust the brightness depending on the ambient light or texture of the object.
Pause Scan		edit the scan data or change the view angle after pausing.

Caution

- Please hold the scanner upright to start to preview/scan.
- When performing a scan, please ensure that there is sufficient VRAM (video random access memory) to prevent any scanning abnormalities or issues.
- When scanning for details or small holes, scan as close as possible to the object.

Generate point cloud

When finishing the scan, you can choose to **Generate Point Cloud**¹ or **Optimize and Generate Point Cloud**², and then to [edit the data](#) later.

Note

The time it takes to generate point cloud depends on the data size of your project and the hardware configuration of your PC.


1. Finish the scan and generate point cloud. [←](#)

2. After the point cloud is generated, it will automatically optimize the point cloud with larger memory. This method will take a long time and require high memory, but it can solve most of the layering problems caused by accumulated aligning errors. For projects with high precision requirements, please choose Optimize and Generate Point Cloud. [←](#)

Data editing

To edit the scanned data when you pause or after you generate the point cloud.

Edit scanned data

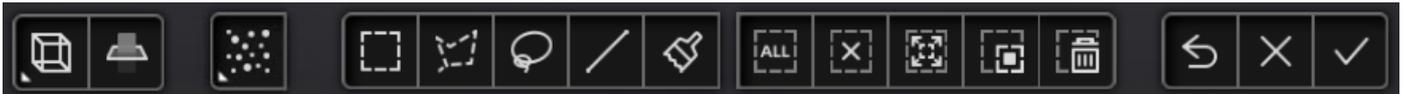

Icon	Function	Instruction
	Multi View	6 different view angles to choose.
	Cutting Plane	Create a plane to do quick cut. For more, see Cutting plane .


Icon	Function	Instruction
	Point Cloud Edit	Edit the selected data area in the point cloud edit mode.
	Markers Edit	Click Point cloud Edit again to switch to Markers Edit. Select the data area and the mark points in this area will be shown in red. The red mark points can be deleted at this time.

Icon	Function	Instruction
	Rectangular	Select/Deselect a rectangular area. The selected area is displayed in red.
	Polygon	Select/Deselect a polygon area.
	Lasso	Select/Deselect the area by using the Lasso tool.
	Straight line	Hold down Shift and left mouse button(LMB) and move the cursor to draw a straight line to select/deselect the area.
	Brush	Hold down both Shift and left mouse button(LMB) and a red circle will appear. At this time, roll the mouse wheel will zoom in and out of the circle. Move the red circle to select/deselect the area to be edited.
	Select All	Select all of the data.
	Unselect	Cancel All Selected Areas.
	Connected Domain	Click the button after selecting a patch of data and all connected region to the selected data will be picked.
	Invert	Revert the selection.
	Delete Selected Data	Delete selected data.
	Undo	The last deletion will be undone.
	Cancel Edit	Undo all edits, and exit the edit mode.
	Apply Edit	Click the button or space bar to apply the edit, and exit the edit mode.

Caution

Once the edit has been applied, the original state cannot be restored, but only by reloading the file.

Shortcut

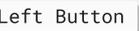Shortcut	Function
Press and hold the  and move the cursor	Rotate the data
Press and hold the  and move the cursor	Translate the data
Hold down  + 	Select the area of data
Hold down  + 	Deselect the area of data
Scroll Wheel	Zoom in/Zoom out the data
	Apply the edit
	Delete the selected data

Cutting plane

Remove the base data from the whole scanned data by creating a cutting plane.


Create cutting plane

1. Click 
2. Select the creation method and follow the interface prompts to create the cutting plane.

Method	Instruction
Fitting Point Cloud	Press Shift + LMB to select data, and then click Generate Plane . The direction of the plane will be calculated by the software according to the direction of point cloud.
Creating Straight Line	Press Shift + LMB to draw a line, and generate the cutting plane according to the line.
By Markers	Press Shift + LMB to select markers.  Note 3 markers or more are required to generate the cutting plane.

3. Click **Create Plane**.

Set cutting plane

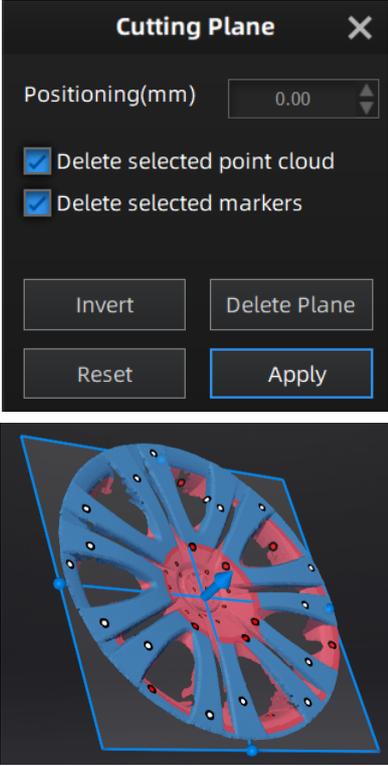Illustration	Instruction
 <p>The screenshot shows the 'Cutting Plane' dialog box with the following elements: a 'Positioning(mm)' input field set to 0.00, two checked checkboxes for 'Delete selected point cloud' and 'Delete selected markers', and four buttons: 'Invert', 'Delete Plane', 'Reset', and 'Apply'. Below the dialog is a 3D model of a wheel with a blue cutting plane and red data points.</p>	<ul style="list-style-type: none">● Delete selected point cloud/markers: Data/Markers in the reverse direction will be shown in red after checking the box. The red data will be deleted after clicking Apply. <p>Note</p> <ol style="list-style-type: none">1) You can not delete all point cloud data.2) Please keep at least 3 or more markers on the front of the cutting plane. <ul style="list-style-type: none">● Invert: Inverse the normal direction of the cutting plane.● Delete Plane: Delete the created cutting plane.● Reset: Reset all operations after creating the cutting plane.● Apply: Apply all edits. <ul style="list-style-type: none">● Positioning: After generating the plane, fill in a number in the positioning box or drag the cutting plane normal arrow  to translate the cutting plane.● Rotate the cutting plane: Cutting plane can be rotated around the axis by dragging the small ball .

Functions

You can use the functions of the sidebar both before and after scanning.

Icon	Function	Instruction
	Project Group	Create / Open a project group. About project group, please refer to Project Group .
	Delete Your Scan	Delete the current point cloud data to rescan.
	Align	Align the data as you need. For more, see Align .
	Save Your Scan	Save the scanned data.
	Mesh Model	Move to the Post Processing to mesh .

Alignment

This is how you align multiple projects in one project group.

Click  on the right side of the interface to enter the project alignment interface.

Mode	Description	Note
 <p>By Feature</p>	<ol style="list-style-type: none"> 1. Choose By Feature. 2. Select the project which needs alignment in the fixed window and the floated window. 3. Click Apply to align. 	<p>Regular shaped objects (circular objects and square objects included) or small sized objects are not suitable for this mode.</p>
 <p>By Manual</p>	<ol style="list-style-type: none"> 1. Choose By Manual. 2. Manually choose at least 3 common points on the data in the fixed window and the floated window respectively. 3. Click Apply to align. 	<ul style="list-style-type: none"> • The chosen points should not in a line. • Manual alignment is a supplement to feature alignment, which can solve the problem of feature alignment failures such as some areas with few common areas or extremely similar areas.
 <p>By Markers</p>	<p>If the currently selected project is a marker project, the marker alignment can be performed. The software will automatically align according to the mark points.</p>	<p>The two projects have no less than 3 common markers each other.</p>
 <p>By Manual Markers</p>	<p>Manually choose at least 3 common markers on the data in the fixed window and the floated window respectively and click Apply to align.</p>	<p>The chosen markers should not in a line.</p>

 **Note**

You should **generate point cloud** before **aligning**.

Post processing

Mesh model


Meshing is to convert the point cloud into a triangular mesh surface. The data after mesh can be directly used for rendering, measurement or printing.

Mesh optimization can optimize the quality of the data.

Mesh optimization

Illustration

Option

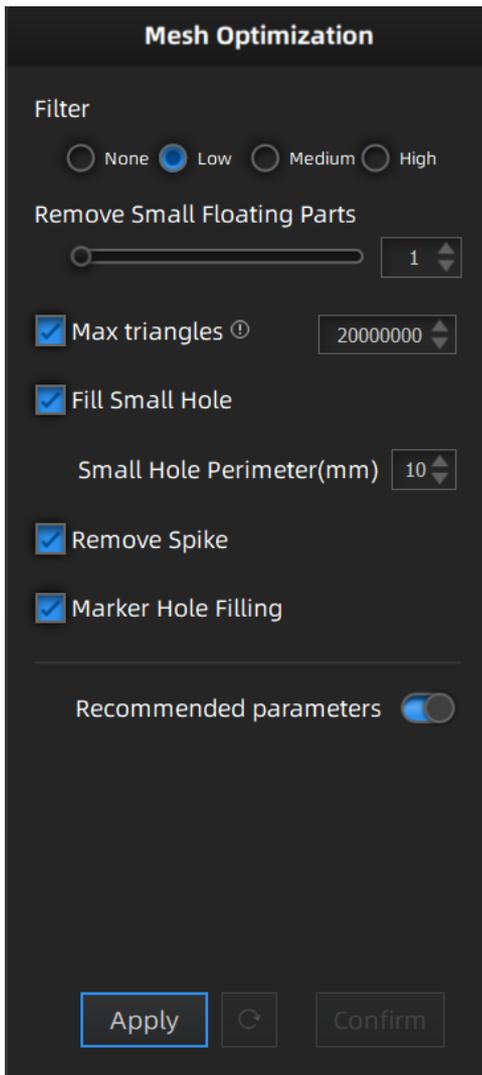

●Filter: Optimize the data and improve the clarity of the data. The higher the level, the less the small details.

- None: No optimization.

- Low: Optimize data slightly and preserve data features.

- Med: Reduce the noise on the surface of the scan data.

- High: Reduce the noise on the surface of the scan data and sharpen it powerfully.

●Remove Small Floating Parts: Remove small floating parts on the model.

●Max triangles: Set max plate number to get mesh model's triangle plate number is within configured plate number.

- Please enter this value reasonably to avoid over-simplification resulting in poor data quality.

- Avoid entering extremely small numbers.

●Fill Small Hole: Automatically fill the small holes with a smaller perimeter than the number input.

●Remove Spike: Remove spike-like data on the image edge.

●Marker Hole Filling: Fill in the holes on the surface of objects that are not scanned due to being covered by markers.


●Recommended Parameters: When turning on, it will automatically use the recommended parameters for meshing.

Mesh editing

After the model data is meshed, the software automatically switches to the post-processing interface. Alternatively, users can directly click on the navigation bar to enter the post-processing interface and import the data.


Left panel

Click + to check the function.

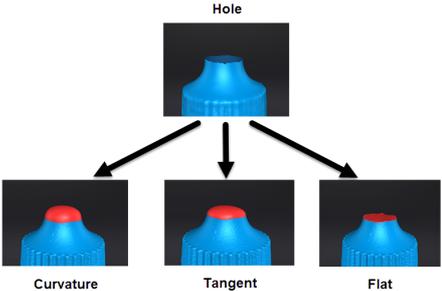Function	Instruction	Note
Simplification	<p>After simplification, the polygon numbers, file size and detail of data will be reduced universally.</p> <p>Set the ratio from 0 to 99 and the default is 0.</p>	The result will not be added by multiple operations on Simplification .
Mesh Optimization	<p>Mesh optimization can optimize the quality of the data by adding more triangles to curvature regions.</p> <p>Set the ratio from 0 to 100 and the default is 0.</p>	/
Smooth	<p>Smooth the possible noise on the surface of the scan data.</p> <p>Set the ratio from 0 to 100 and the default is 0.</p>	It might remove some small details or smooth some sharp edges at the same time.
Remove Small Floating Parts	<p>Remove small floating parts which are not connected to the main data.</p> <p>The maximum value is the square of the diagonal length of the floating part/10, $MAX=(L/10)^2$.</p> <p>Set the ratio from 0 to 100 and the default is 0.</p>	The result will not be added by multiple operations on Remove Small Floating Parts .
Auto Hole Filling	<p>Automatically fill all holes with a smaller perimeter than the number input.</p>	<p>Filling type:</p>  <p>The diagram illustrates three different ways to fill a hole in a mesh. At the top, a hole is shown in a blue mesh. Three arrows point down to three different filling methods: 'Curvature' (the hole is filled with a smooth, curved surface), 'Tangent' (the hole is filled with a flat surface that is tangent to the hole's edge), and 'Flat' (the hole is filled with a completely flat surface).</p>
Manual Hole Filling	<p>Choose the filling type and click the holes to be filled.</p> <p>The hole edges are shown in green and the holes get red after filling.</p>	/
Cutting Plane Tool	<p>Define a plane by drawing a straight line.</p> <p>Delete the selection and close the mesh at the intersection. Use the cutting plane to align the mesh to the CSYS.</p>	/

Create features

Click  to display the menu of creating features. To close the menu, please click the icon again, or click **Close**.

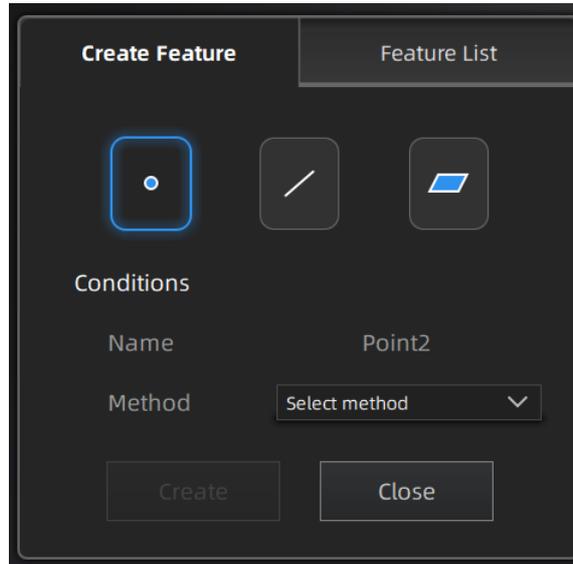

Point

Creation Method	Description	Note
Selected Points	<ul style="list-style-type: none">Click on the data to select a point.Click Create to create a point.	/
Line-Plane Intersection	<ul style="list-style-type: none">Click on the created line, or select it on the dropdown.Click on the created plane, or select it on the dropdown.The point generated is the intersection between the non-parallel line and plane.	<p>Line and Plane should be created in advanced.</p> <p>The line should not be parallel to the plane.</p>

Line

Creation Method	Description	Note
Point-Point	<ul style="list-style-type: none"> Pick 2 points. Click on the data to select a point or click on a feature point previously created. In the Choice list select one of the points to redo it. The line generated is define as point from to point to point. 	/
Plane-Plane Intersection	<ul style="list-style-type: none"> Click on the plane previously created, or select it on the dropdown, repeat for the second plane. The created line is the intersection between the 2 non-parallel planes. 	<p>2 planes should be created in advanced.</p> <p>The planes should not be parallel to each other.</p>

Plane

Creation Method	Description	Note
3 Points Fit	<ul style="list-style-type: none"> The plane is generated by 3 points not co-linear. Click on the data to select one point or click on a previous created feature point. In the Choice list select one of the points to reselect it. <p>Feature creation failed! Error code 6: the points selected are co-linear.</p>	The 3 points can't be on the same line.
Point-Line Fit	<ul style="list-style-type: none"> The plane generated includes the point and the line (The line should be created in advanced). Click on the line previously created or select it from the drop-down. Click on the data to select a point or click on a feature point previously created. <p>Feature creation failed! Error code 6: the point selected belongs to the line.</p>	Line should be created in advanced
Best Fit	The plane generated is the position with the smallest deviation from the selected area.	/

Movement


Use this mode to modify the alignment of the data to the global coordinate. This action is useful for post processing or reverse engineering.

Caution

- The shape and accuracy of the model will not be changed by the movement.
- After the movement and exiting, the changes are irreversible so you can only reset the model by reloading the original file.

Click  to enter the movement interface. Click it again to exit.

Exact Movement

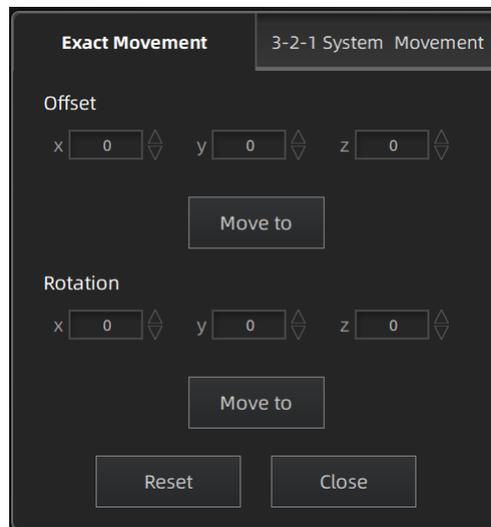

Click **Move to** to align the model center with the input coordinates, and the axis direction is adjusted to match the input rotation angle.

The coordinate system displayed on the interface is the global coordinate system, in which the direction of the red line is the positive direction of X-axis, green is the positive direction of Y-axis and blue is the positive direction of Z-axis.


Click **Reset** to cancel all the transformation in the exact movement interface.

Click **Close** to save the results and exit.

3-2-1 System Movement

3-2-1 system movement aligns data by selecting the point, line and plane. Before movement, create feature points, lines and planes. The feature lines created are not perpendicular to the plane.

The coordinate system on the interface represents the global coordinate system: Red=X+, Green=Y+, Blue=Z+.

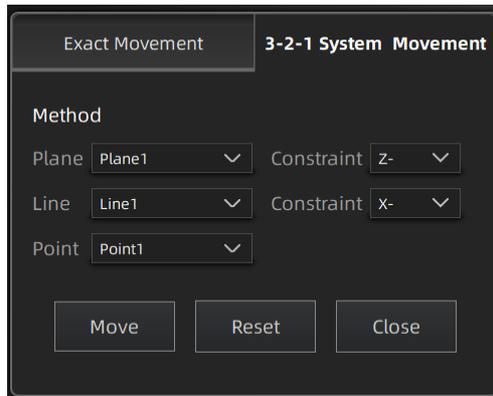

- Select a feature surface in the plane drop-down menu, and select an axis in the corresponding constraint drop-down menu of the plane. The arrow on the plane corner indicates the positive direction of the plane, and the selected axis direction will be consistent with the plane direction.
- Select a feature line in the drop-down menu of the line, and select an axis in the drop-down menu of the line. The arrow of the line indicates the positive direction of the line, and the direction of the selected axis will be consistent with the direction of the projection of the line on the selected plane.
- Click the drop-down menu to select a point, the position of this point is the origin of the coordinates (0, 0, 0).

Click **Move** to start the coordinates transformation. When the lines are perpendicular to the plane, the transformation fails, so the movement fails.

Click **Reset** to cancel all the transformation in the 3-2-1 system movement interface.

Click **Close** to save the results and exit.

Measurement tools

Click  to enter the measurement interface and the menu is displayed. Click it again to exit.

Measurement	Description	Steps
Distance	Calculate the distance between two points on the surface of the model. <ul style="list-style-type: none"> • Total is the 3D distance. • X, Y and Z are the projection of the segment to the respective planes. 	Click on the surface of the model to pick two points, the calculation will be done automatically.
Surface Area	Calculate the surface area value.	<ul style="list-style-type: none"> • Press ↑ Shift + Left Button and move the cursor to select an area • Press ^ Ctrl + Left Button and move the cursor to unselect. • ^ Ctrl + A to select all. • Press ^ Ctrl + C to deselect all the data.
Volume	Calculate the volume of the watertight data .	It returns the volume in mm ³ and the coordinates of the bounding box.  Note: Only available for watertight mesh .

Save

Save data

You can save the scanned data.

Click  to select the save path and the file format, enter the file name as well.

Note

The project on the features/hybrid mode(98 lines) cannot be saved as the .p3 format in the scanning interface; only the point cloud data(.asc) can be saved in the post-processing interface.

Format	Data Type	Saved as	Application
ASC (whole piece)	Optimized cloud points	scan.asc	<ul style="list-style-type: none"> • Quick export and no need for post-operation. • Use other software to post-possess the data.
STL	Mesh data	scan.stl	<ul style="list-style-type: none"> • 3D printing. • Reverse engineering. • Compatible with most post-processing software.
PLY	Mesh data	scan.ply	<ul style="list-style-type: none"> • Compact size. • Easy for texture editing.
OBJ	Mesh data	scan.obj scan.jpg scan.mtl	<ul style="list-style-type: none"> • Used for artworks. • 3D rendering. • Compatible with most post-processing software.
3MF	Mesh data	scan.3mf	<ul style="list-style-type: none"> • Compact size. • Compatible with Microsoft 3D printing software
P3	Global markers	scan.p3	<ul style="list-style-type: none"> • Reuse the markers' position. • Can also contain the cutting plane.

Date sharing

You can upload the encapsulated data to Sketchfab.

Click  to upload the encapsulated data to Sketchfab, where the title, username and password are required to be provided. You can register an account on the [Sketchfab](#) to view the shared models.

 **Caution**

The files uploaded are in stl format.

Third-party software

You can import scanned mesh data into the third-party software.

Icon	Name	Description
	Export data to Geomagic Control X(2020)	Mainly used for metrology. If the GeomagicControl X software has been installed, clicking this button will open the GeomagicControl X software and import the mesh data.
	Export data to Verisurf(2020)	Mainly used for metrology. If the Design with Verisurf software has been installed, clicking this button will open the Design with Verisurf and import the encapsulated stl data into Design with Verisurf.
	Export data to Geomagic Design X(2020)	Mainly used for reverse engineering of mesh data. If the GeomagicDesign X has been installed, clicking this button will open the GeomagicDesign X and import the mesh data.
	Export data to Geomagic Essentials(2.0.1.3000)	Mainly used for reverse engineering of mesh data. If the GeomagicEssentials has been installed, clicking this button will open the Geomagic Essentials and import the mesh data.
	Export data to Solid Edge SHINING 3D Edition(2021)	Mainly used for reverse engineering of mesh data. If Solid Edge has been installed, clicking this button will open the Solid Edge and import the encapsulated stl data into Solid Edge.
	Export data to Polyworks Metrology Suite(2022)	Mainly used for metrology. If Polyworks Metrology Suite has been installed, clicking this button will open it and import the encapsulated stl data into Polyworks Metrology Suite.

Contact us

By Email: metrology_support@shining3d.com 

Support platform: support.shining3d.com 

Shining 3D Offices

APAC Region & Headquarters

SHINING 3D Tech Co., Ltd.

Hangzhou, China

Phone: +86 571 82999050

Add: No. 1398, Xiangbin Road, Wenyan, Xiaoshan, Hangzhou,
Zhejiang, China, 311258

EMEA Region

SHINING 3D Technology GmbH.

Stuttgart, Germany

Phone: +49 711 28444089

Add: Breitwiesenstraße 28, 70565, Stuttgart, Germany

Americas Region

SHINING 3D Technology Inc.

San Leandro, United States

Phone: +1 415 259 4787

2450 Alvarado St #7, San Leandro, CA 94577